



Handrad	kv gemessen
0	4,3
0,5	4,2
1	4,1
1,5	3,9
2	3,4
2,5	2,1
3	1,3
3,5	0,9
4	0,4
4,5	0,25


0,4

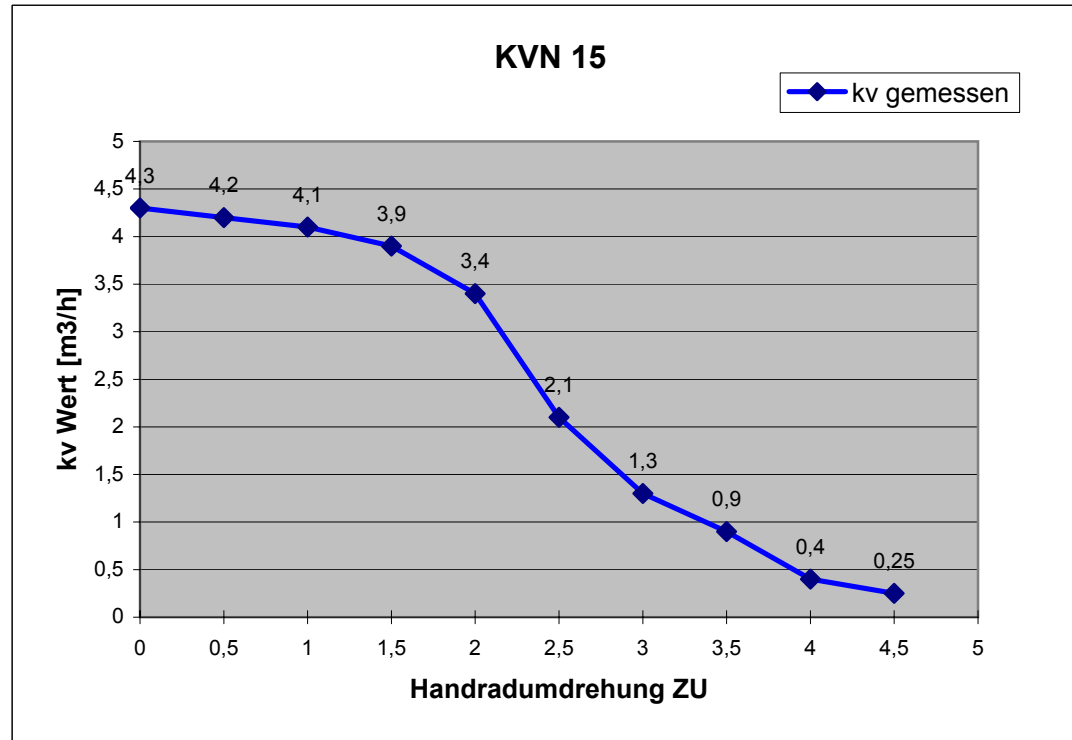


Handrad	kv gemessen
0	7,6
0,5	7,1
1	6,3
1,5	5,1
2	3,35
2,5	2,2
3	1,64
3,5	1,26

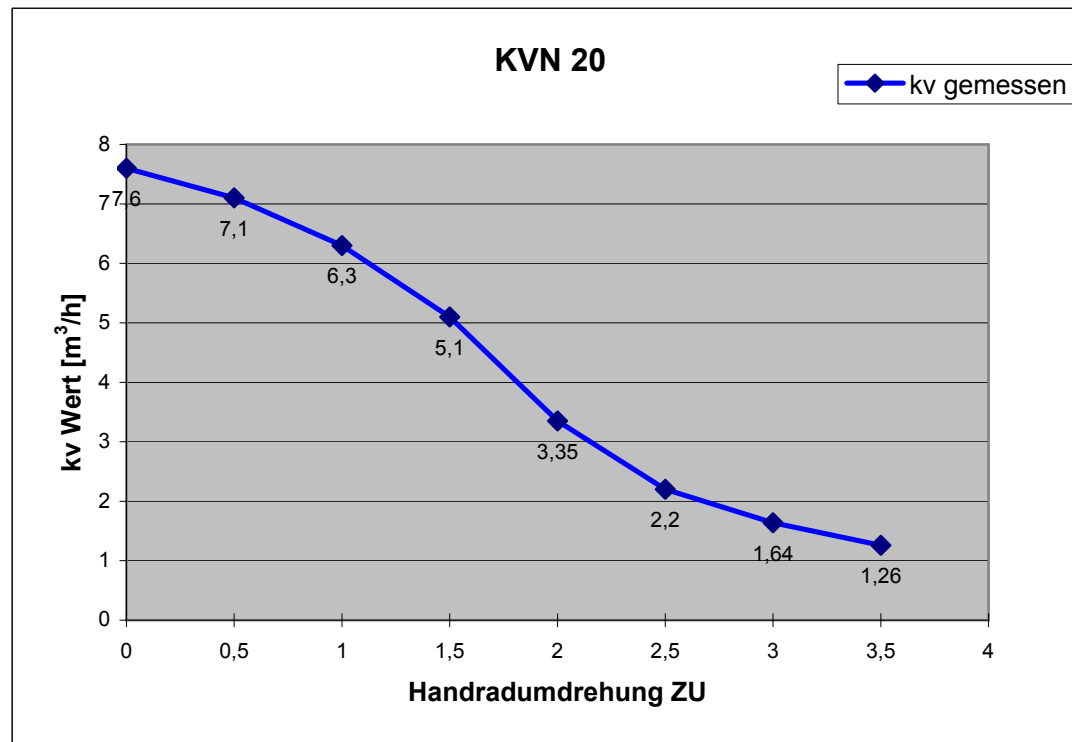


Handrad	kv gemessen
0	12,1
0,5	11,9
1	11,7
1,5	11
2	9,6
2,5	7,4
3	5
3,5	3,3
4	2,6
4,5	2
5	0,8

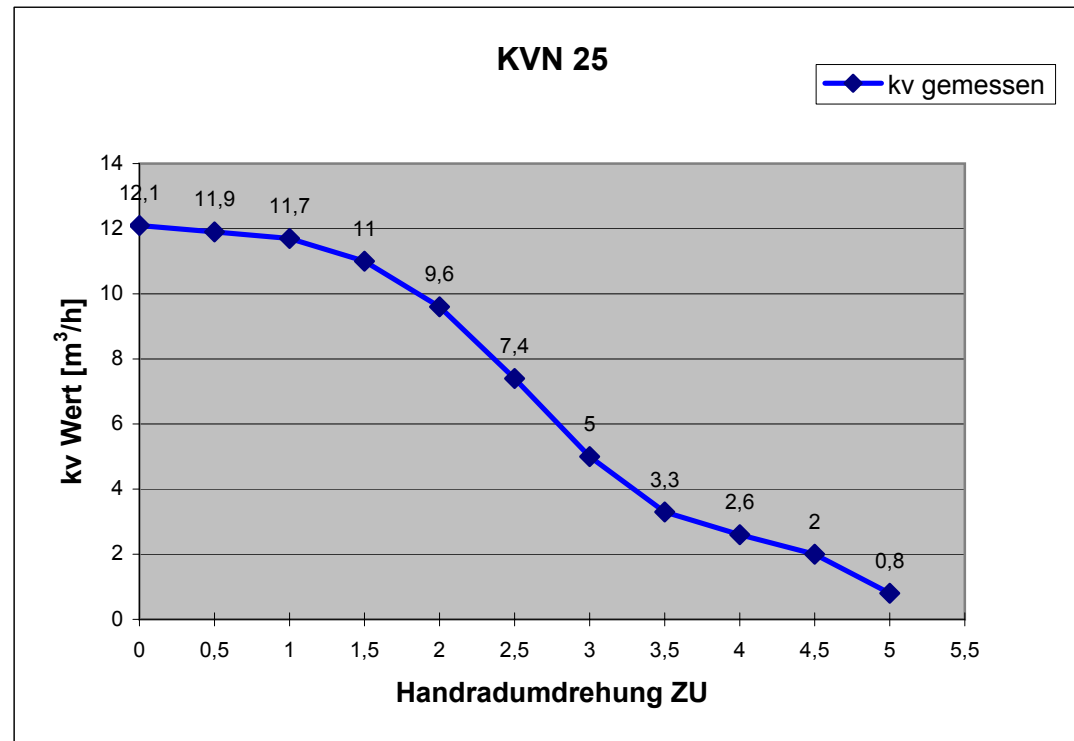


Handrad	kv gemessen
0	20,5
0,5	18,8
1	16,8
1,5	13,6
2	11,3
2,5	8,5
3	6,4
3,5	4,9
4	3,4
4,5	2,5
5	1,9
5,5	1,4

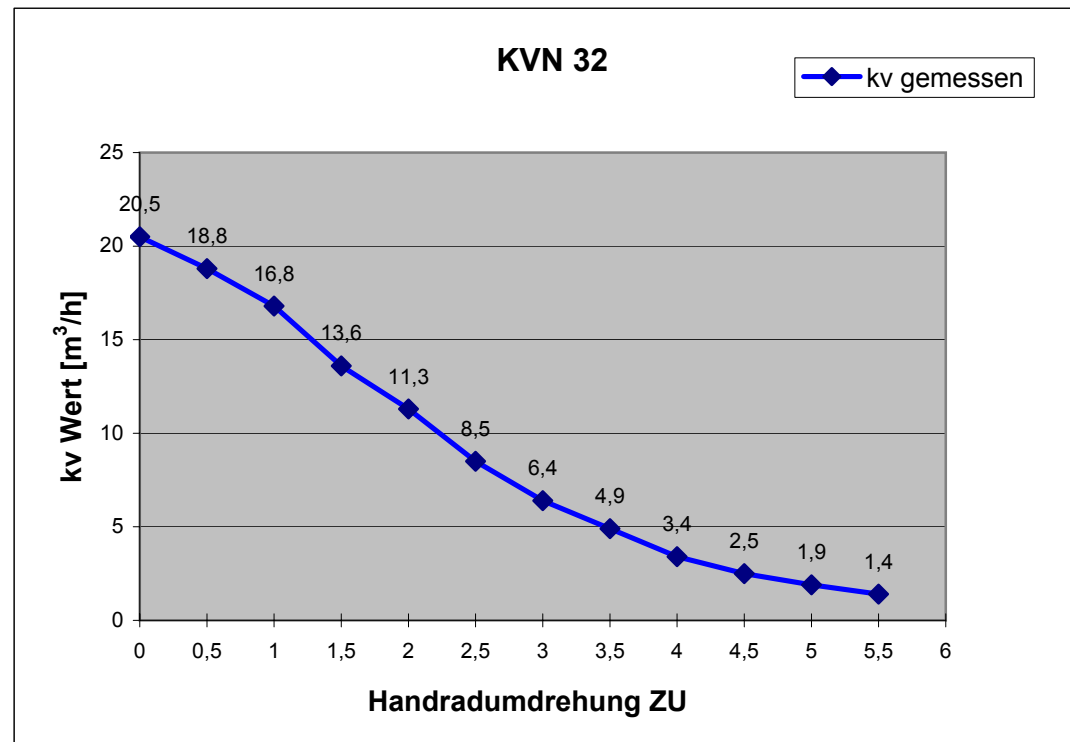


Handrad	kv gemessen
0	32
0,5	29
1	27,5
1,5	26,8
2	26
2,5	25,3
3	23,5
3,5	18,5
4	14
4,5	10
5	6,5
5,5	3
6	2,8

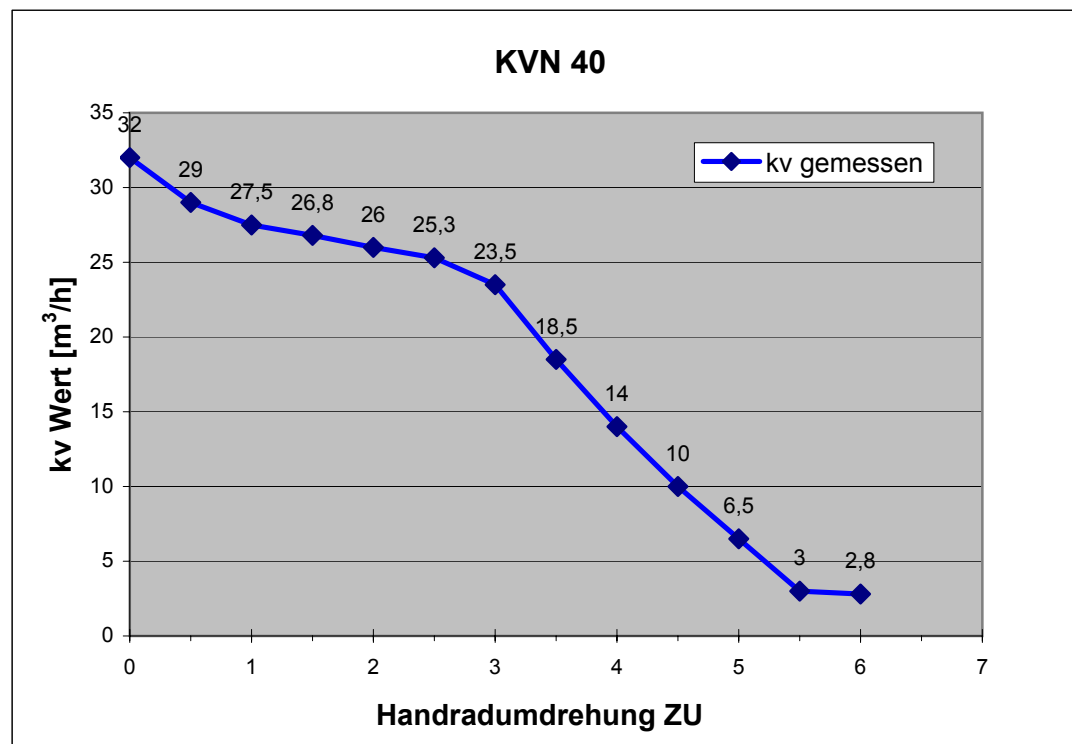


Handrad	kv gemessen
0	50
0,5	46,6
1	45,6
1,5	44,7
2	42
2,5	38
3	29,6
4	14,15
5	3,6
6	3

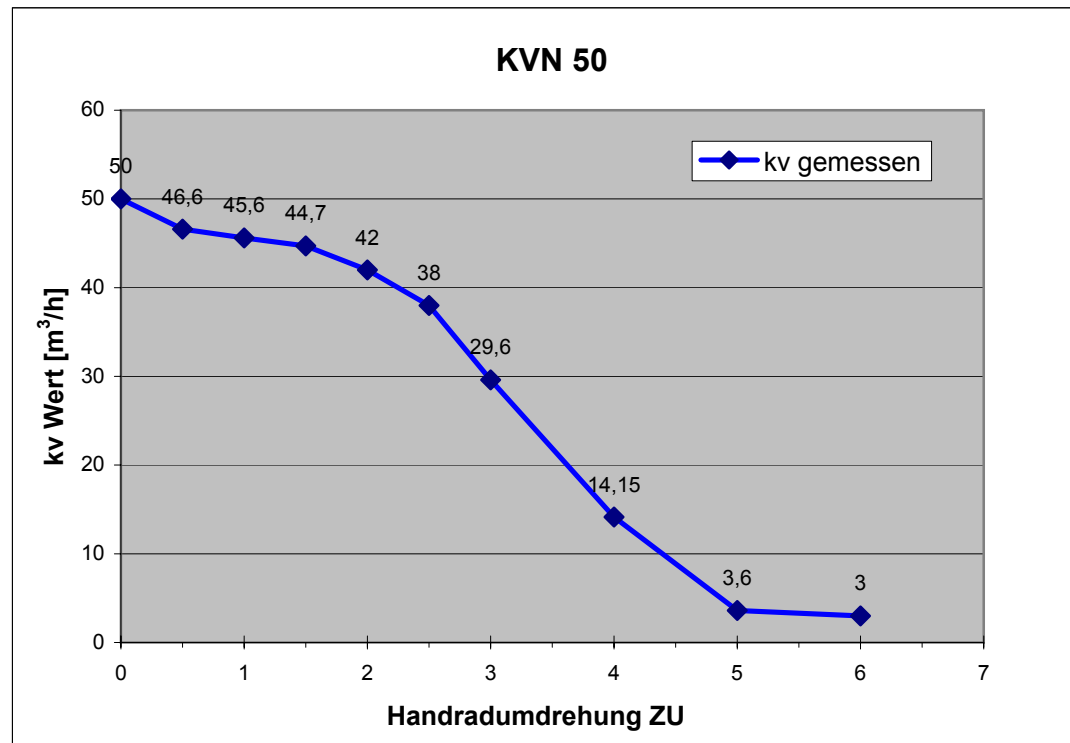


Handrad	kv gemessen
0	69
1	59,7
2	53,4
3	43,2
4	24,4
5	12,6
6	8,4

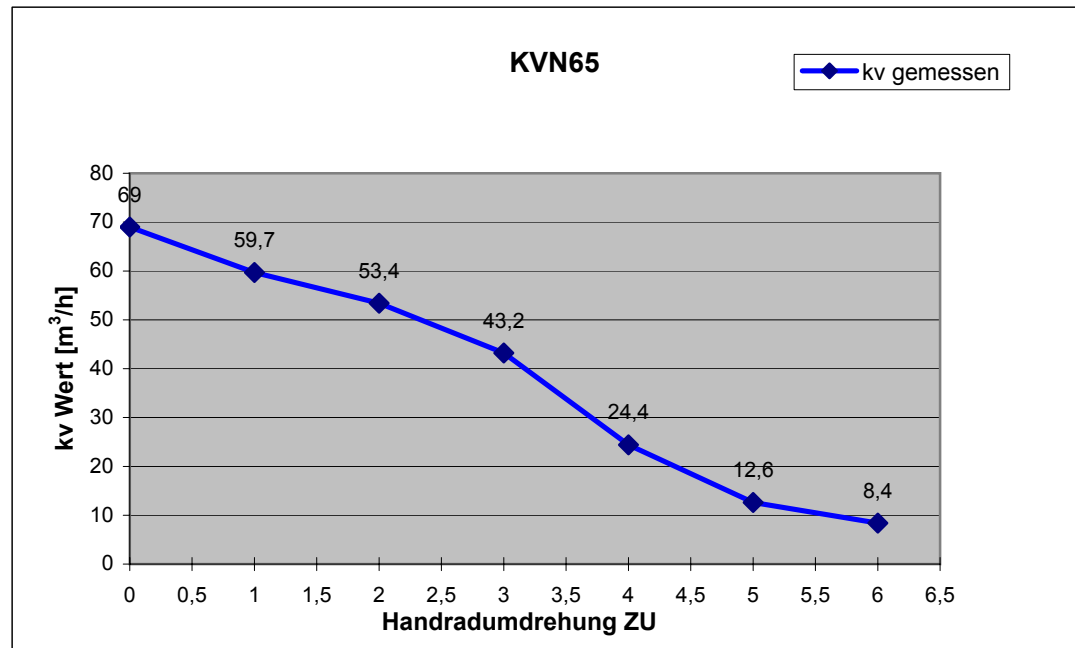


Handrad	kv gemessen
0	104
1	100,4
2	93,4
3	80,9
4	64
5	42,7
6	24,4
7	6
8	2

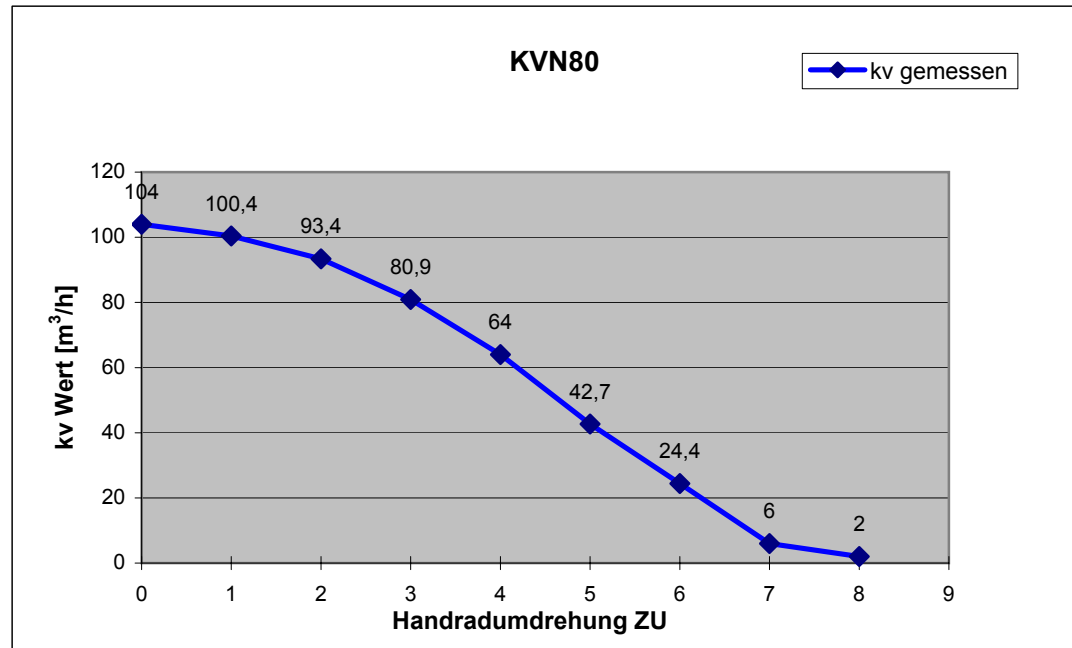


Handrad	kv gemessen
0	163,2
1	160,6
2	155,6
3	151
4	139,6
5	115,4
6	89,4
7	47,8
7,5	28
8	16
9	5

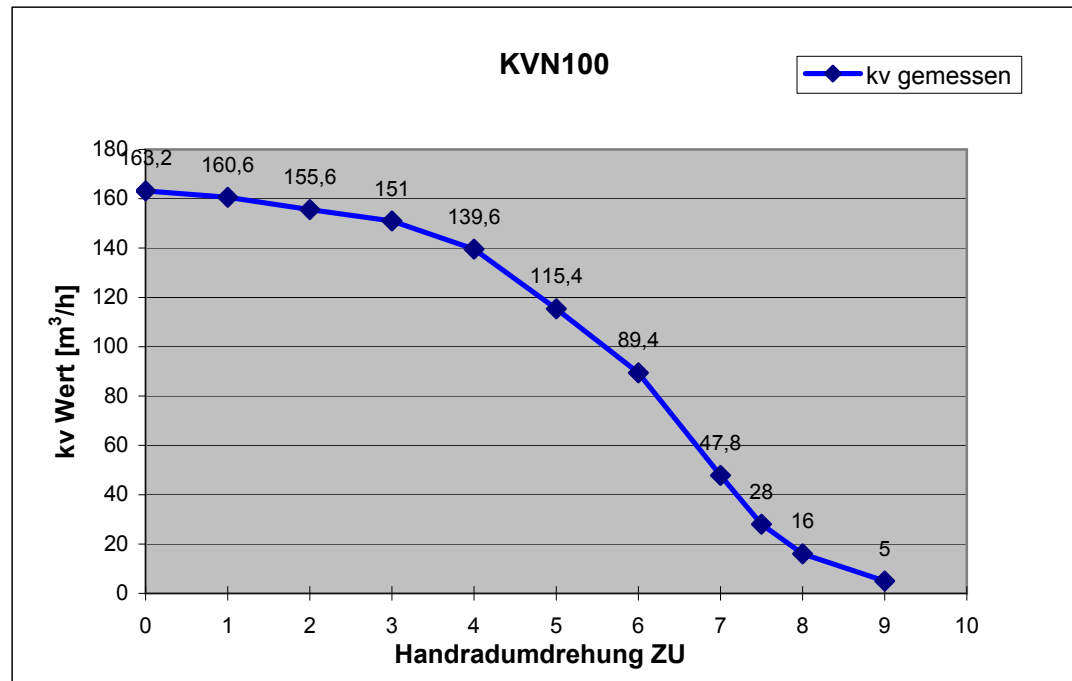

Handrad	kv gemessen
0	233
1	232
2	230
3	227
4	217
5	200
6	179
7	151
8	114
9	74
10	33
11	11

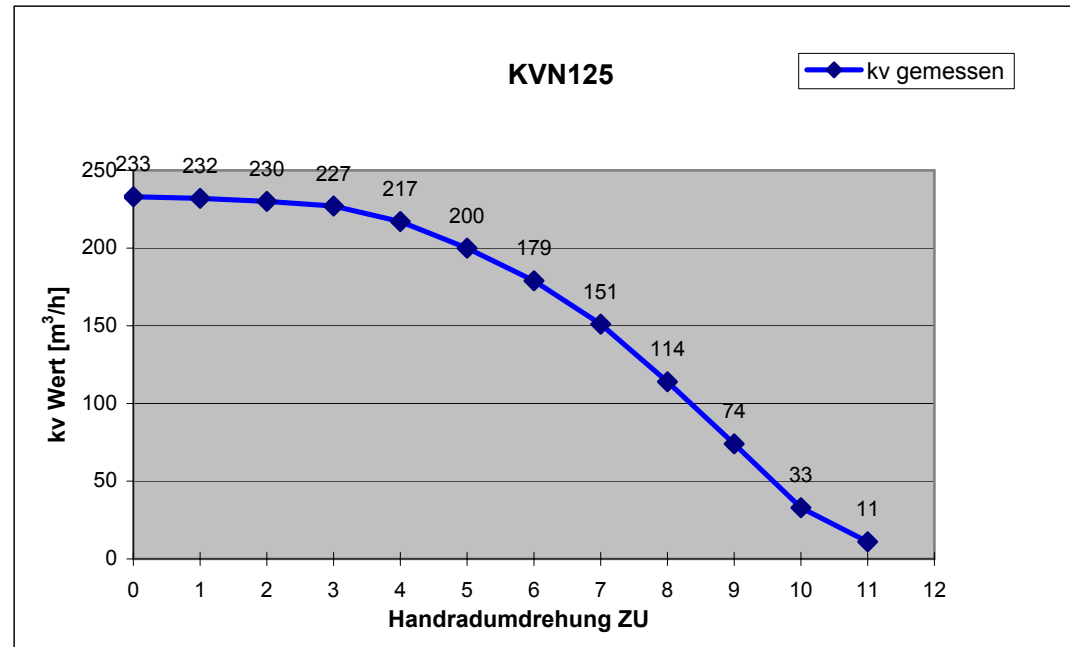

Handrad	kv gemessen
0	333
1	332
2	330
3	325
4	308
5	293
6	274
8	211
9	164,5
10	110,9
11	67,9
12	34
13	9,5

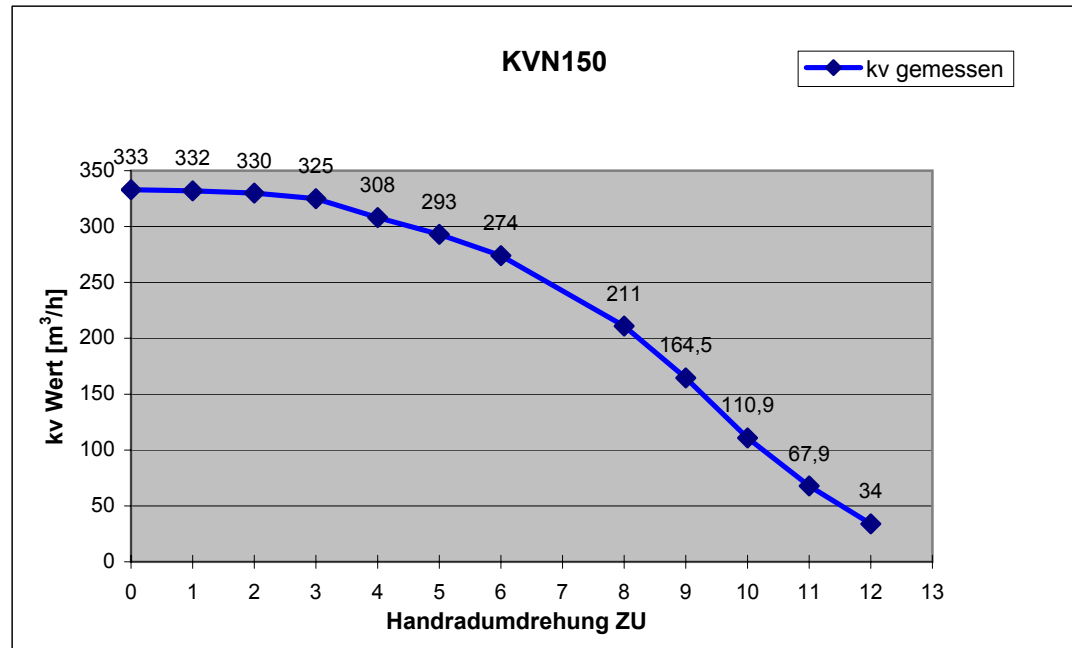

Handrad	kv gemessen
0	579
1	581
2	584
3	576
4	566
5	550
6	528
8	483
9	441
10	407
11	362
12	305
13	238
14	167
15	105
16	62
17	23
18	17
19	13

